

Matt Preview screens are considered by leading cinema exhibitors and laboratories worldwide to be the 'premier' projection surface for screening rooms and preview theatres. The flexible PVC based material and coating is manufactured to a unique Harkness formulation and specification, providing a wide viewing angle, high contrast, bright pictures and excellent colour temperature. Noted for invisible seams under normal projection conditions.

	Matt Preview	Matt Preview MP
<b>Application</b>	Cinema, Home Theatre, Roller Screen	Preview Theatre, Cinema, Screening Room, Home Theatre, Roller Screen
<b>View Distance</b>	Minimum of 5mtr (15') recommended on perforated surfaces	Minimum of 1.5m (5')
<b>Maximum Size</b>	USA manufacture 23.77 x 12.19m (78' x 40') Europe manufacture 33m x 11m (108' 3" x 36' 1")	
<b>Perforation Size</b>	1.2mm (0.047")	0.50mm (0.020")
<b>Perforation Density</b>	4.5%	1.7%
<b>Weight</b>	0.50kg/m <sup>2</sup> (0.10lb/ft <sup>2</sup> )	
<b>Eyelet Spacing</b>	150mm (6") nominal (US) / 200mm (8") France	
<b>Typical Packing</b>	Rolled in a cardboard tube; packed in a long wooden box when height is over 7m (23')	
<b>Fire Certification</b>	Italy Class 1	
<b>Surface Edging Options</b>	<ul style="list-style-type: none"> <li>• Web and eye (grommet). Triple fold web integral with surface</li> <li>• Cloth web and fixings (snaps) for press stud frames</li> <li>• Cut square (unfinished edge)</li> </ul>	<ul style="list-style-type: none"> <li>• Preformed pipe pocket any size on any side</li> <li>• Straight sides or shaped to special order</li> </ul>

**Despatch/Storage**

Screens should normally be transported and stored at temperatures between 5C and 30C (40F and 85F), with relative humidity less than 80%. If screens are very cold (e.g. following air transport) then they must be allowed to warm up before unpacking, otherwise cold cracking may occur. Screens should be installed within a maximum of 2 months of shipping. Packages should be handled with care to avoid damage.

**Installation**

The following principles should be followed when installing Harkness Perlux screen surfaces:

- The auditorium should be clean with no building works taking place.
- Installation should be at ambient temperature (20/24C-68/75F).
- Care should be taken to avoid the screen coming into contact with sharp objects during installation.
- Excessive loads should not be placed on any specific point of the screen.
- Use of cotton gloves is recommended.
- The viewing surface should not be touched (the rear of the screen is identified by the product label).
- Creasing should be minimised during installation.

There are two principal methods to install the screen:

- Flying the screen by attaching several tie lines to the top of the screen, passing these over the top of the frame and using them to pull the screen into place.
- Unrolling the screen vertically across the front of the frame.



Using one of these methods, the screen surface is loosely attached to the top of the frame. After this, the top of the screen is fully attached to the top lacing bar by working from the centre out using each eyelet.

The lower edge of the screen should then be laced from the centre outwards, applying sufficient tension to pull the screen flat. Typically, the screen can be stretched up to 5% of its height at ambient temperature of 20/24C-68/75F using sisal cord lacing. Side lacing should be from the top down and sufficient to remove the flutes. Excessive side tension should be avoided, particularly on a curved frame, as it will result in straightening of the screen across the curve (belly).

Springs or elasticated ties are not recommended to install Harkness surfaces. The above method can be used for both lace-in and for wrap-round frames. Normally, two people are sufficient to install a screen.

**Care and Maintenance**

The general environment where the screen is installed should be kept reasonably clean to avoid dirt and dust build-up. Screens can be periodically cleaned using a soft brush or cloth, doing this vertically with limited pressure. Screens can be cleaned using a damp cloth wetted with water and a mild detergent. Under no circumstances should screens be cleaned with abrasive materials or harsh chemicals such as acids, bleaches or solvents. Harkness Screens is not liable for damage caused to screens through the use of inappropriate cleaning methods or chemicals.

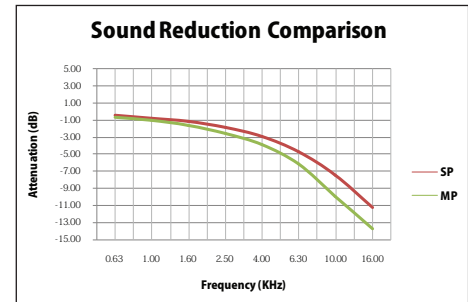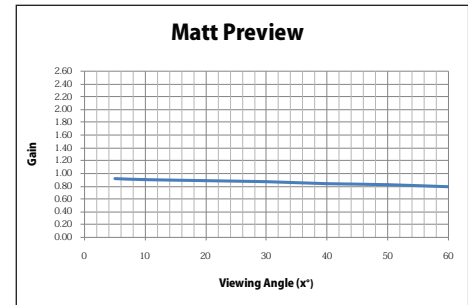

In the interest of product enhancement, Harkness Screens reserves the right to introduce modifications or alterations without notice.



UK: +44 (0)1438 725 200 | USA: +1 540 370 1590  
 FR: +33 238 979 776 | CN: +86 106 202 3923  
 Email: sales@harkness-screens.com | Web: www.harkness-screens.com